USER'S MANUAL

2 Megapixel IR Bullet Camera

Before installing and using the camera, please read this instructions thoroughly and keep for reference.

TABLE OF CONTENTS

Table of Contents

Precautions	3
Introduction and Features	4
Dimensions	5
Accessories & Connectors	6
Installation	7
Main Menu	8
Exposure	9
White Balance	11
Image	12
Intelligent	14
Special Function	15
Display	16
Specifications	17

PRECAUTIONS

- Avoid prolonged use in high temperature and high humidity environment Use the product within the operating range specified in the specifications. Avoid locations where heat is generated, and Install in a well-ventilated place.
- Do not install the camera in an unstable place
 Confirm that the camera is firmly fixed after installation.
 Dropping the product due to poor installation may cause injury.
- Install the camera away from dusty places
 This may cause product malfunction, poor image quality, fire or electric shock.
- Do not install the camera under unstable lighting conditions It is possible to output an inappropriate image due to severe illumination change or lighting flickering.
- Do not install the camera near gas or oil leaks
 Use in a place with flammable materials may cause fire.
 Also, keep distance from power line cables or use separate metal piping.
- Do not disassemble the camera or insert foreign objects
 There is no warranty liability for products that user disassembled.
- Do not drop the camera or shock it It may cause malfunction.
- Never keep the camera directly face to strong light.

 Exposure to strong light such as sunlight may cause light spreading or light blurring. In addition, direct sunlight can damage the image sensor.
- Prepare for malfunction due to natural disasters


 The grounding work or the installation of the surge protector can minimize damage to the product due to lightning, etc.
- Be sure to check the specifications of the power supply
 Before connecting the power to the product, make sure that the power supply
 meets the recommended specifications.


INTRODUCTION & FEATURES


Features

- 1/2.9", Sony Exmor CMOS sensor
- Built-in 2.8~12mm Varifocal Lens
- Full-HD resolution video output
- Day & Night (ICR)
- On Screen Display
- 2D + 3D DNR (Digital Noise Reduction)
- D WDR (Digital Wide Dynamic Range)
- Privacy Masking function
- Intelligent motion detection
- 3-Axis Camera Bracket for easy installation
- IP67, Aluminum Die-casting Housing
- Built-in 4pcs High power IR-LED
- Camera Control through RS-485
- EX-SDI Video Output
- DC12V Power

DIMENSIONS

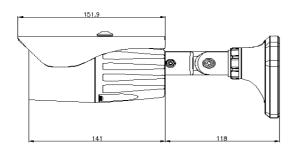

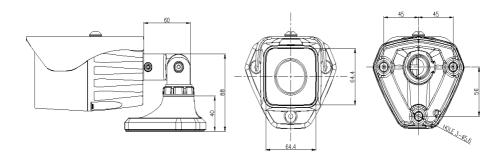


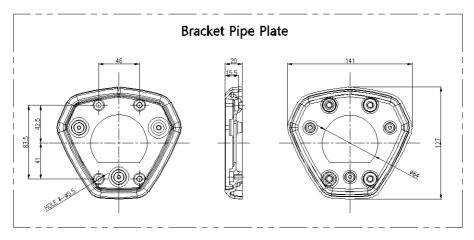

(Unit : mm)


ACCESSORIES & CONNECTORS

ACCESSORIES

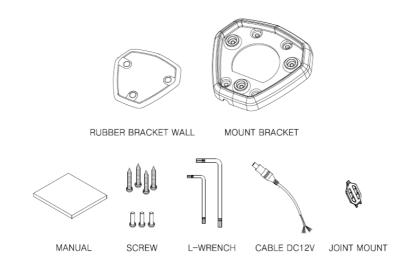

CONNECTORS

- BNC connector can be connected to a monitor, DVR or video transmitter.
- If necessary, user can control camera through RS-485 communication.
- Connect DC12V power to camera (Use more than 1A power adaptor)

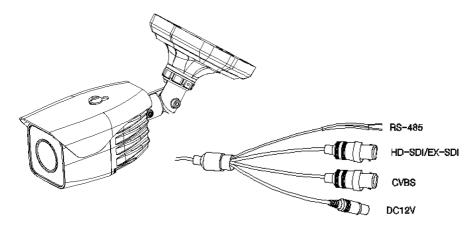

INSTALLATION

1. Mounting the Mount Bracket

- Using the supplied 4 screws, mount the mount bracket to wall or ceiling.

2. Mounting the Camera


- Using the supplied L-wrench, firmly fix the camera to the mount bracket.

3. Supply of power

- Connect DC12V to camera.
- To prevent fire or electric shock, use a reliable power supply.

4. Camera Angle Adjustment


- Adjust the camera direction by turning the pan bracket left or right, the tilt bracket up or down, then fix the screws tight.
- Also, adjust zoom and focus volume to get the desired angle of view.

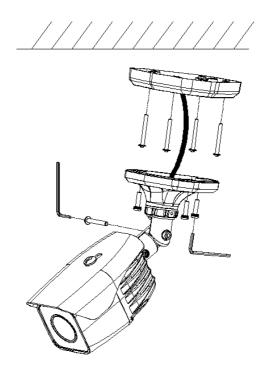

MAIN MENU

Camera menu is subject to change without prior notice for the functional upgrade or quality improvement. Also, we may use additional slip sheet for the change. Please check the camera version and the slip sheet if the camera menu and this manual's menu is not matched.

MAIN MENU

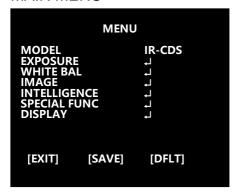

The menu consists of the "Main Menu" and "Sub Menu".

Except MODEL, the rest main menus have associated sub menu. So, if you select each main menu, associated sub menu is displayed.

If you want save the current settings, select [SAVE]

If you do not want save the current settings, select [EXIT] But, before power off \rightarrow on, camera will keep the changed current settings.

If you want to restore the default settings, select [DFLT]


NODEL: Please keep "IR-CDS" setting without change

► D&N, IR-CDS

D&N : Apply to non-IR model only▷ IR-CDS : Apply to IR model

EXPOSURE

EXPOSURE

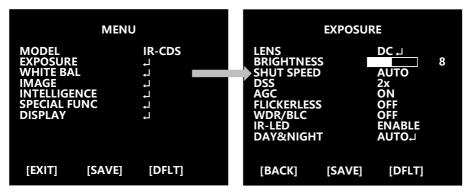


- ◆ LENS MODE : Select LENS mode ▷ INDOOR / OUTDOOR / DEBLUR
- ♦ BRIGHTNESS: Set brightness level ► 0(dark) ~ 20(bright) steps
- DSS: Set maximum DSS (Digital Slow Shutter) operating range.
 OFF / x2, x4, x8, x16, x32
- ♠ AGC : Set Auto Gain Control ► OFF / ON
- ◆ FLICKERLESS: Set Flickerless mode ➤ OFF / ON

EXPOSURE

- ♦ WDR/BLC : Select WDR(Wide Dynamic Range) or BLC(Back Light compensation)
 - ► WDR↓
 - - ► LOW, MID-LOW, MIDDLE, MID-HIGH, HIGH
 - WDR doesn't work in Shutter Manual Mode.
 - * When WDR on, CVBS output is disabled.
 - ► BLC⊿
 - POSITION : Adjust the window position
 - SIZE : Adjust the window size
 - Can't use WDR and BLC at the same time.
 (When WDR On, BLC is Off. And when BLC is On, WDR is Off)
- ♦ IR-LED MODE ► ENABLE/ OFF
- ◆ DAY&NIGHT : Select how to judge Day & Night condition.
 - ► MODE : Please keep MODEL as "IR-CDS" without change
 - AUTO
 - Day&Night condition is decided by built-in illumination sensor.
 - ► DELAY: 0 ~ 255 sec
 - ► THRS: 0 ~ 7
 - ► GAP : LOW, MIDDLE, HIGH
 - ► ANTI-SAT : Improves light saturation by LED (0~20)
 - ► BURST: OFF/ON
 - ► POLARITY: Set external Input polarity (ACTIVE LOW / ACTIVE HIGH)
 - ▷ DAY
 - * Regardless of the ambient illumination, camera keeps Day mode.
 - ▷ NIGHT
 - * Regardless of the ambient illumination, camera keeps Night mode.
 - ► ANTI-SAT : Improves light saturation by LED (0~20)
 - ► BURST : OFF/ON

WHITE BALANCE


WHITE BALANCE

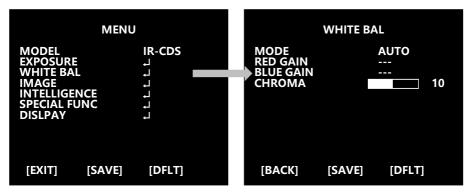

- ♠ AWB : Set WHITE BALANCE mode
 - ► AUTO / ONE PUSH / MANUAL / INDOOR / OUTDOOR / AUTO-EXT
 - ▷ AUTO : Automatically adjusts color according to the lighting condition.
 - ONE PUSH: While ONE PUSH pressed, camera runs the white balance working. if ONE PUSH released, camera stops white balance working.
- ♦ RED GAIN : Adjust R gain value ► 0 ~ 20 steps
- ◆ BLUE GAIN: Adjust B gain value ► 0 ~ 20 steps
- ◆ CHROMA : Adjust CHROMA gain value ► 0 ~ 20 steps

IMAGE

IMAGE

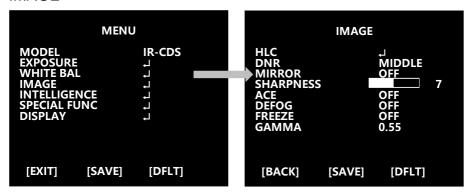

♦ HLC : Set High Light Compensation.

When camera is shooting extremely bright light source, camera masks the area to prevent saturation on the monitor.

▷ LEVEL : 0 ~ 20 steps▷ COLOR : 0 ~ 13 steps


- DNR: Set the use of Digital Noise Reduction
 - ► OFF / LOW / MIDDLE / HIGH
- MIRROR: Set mirror or flip image mode
 - ► OFF / H / V / H&V
 - > H : You can mirror the picture horizontally on the monitor
 - ∨ : You can flip the picture vertically on the monitor
 - > H&V : You can execute mirror and flip at the same time.
- SHARPNESS : Adjust sharpness level
 - ► 0 ~ 10 steps

IMAGE

- ♦ ACE : Set Adaptive Contrast Enhancement function
 - ► OFF / LOW / MIDDLE / HIGH
- DEFOG : Set Defog function
 - ► OFF / ON4
 - ▷ MODE : AUTO / MANUAL
- You can not use DEFOG and ACE at the same time (When ACE On, DEFOG will be Off. Also when DEFOG is On, ACE will be Off)
- ◆ Freeze : This function stops video
 - ► OFF / ON
- ◆ GAMMA : Select Gamma
 - **►** 0.45 / 0.55 / 0.65 / 0.75

INTELLIGENT

INTELLIGENCE

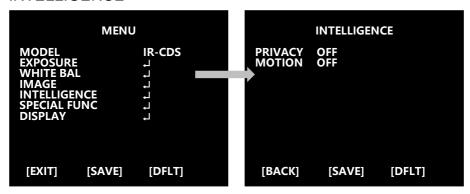

- PRIVACY: You can hide some areas on the screen
 - ► OFF / ON4


 - POSITION : Adjust the position of the mask
 - SIZE : Adjust the size of the mask
 - COLOR : Select mask color (0 ~ 13)
- MOTION: When there is movement on the screen, camera detects the motion.
 - ► OFF / ON4

 - ▷ SENSITIVITY: Set the sensitivity of motion detection (0 ~ 20 steps)
 The lower number, the higher sensitivity.
 - ightarrow POSITION : Adjust the position of motion detection area
 - > SIZE : Adjust the size of motion detection area

 - DWELL TIME : Set the motion alarm duration time (0 ~ 255sec)

SPECIAL FUNCTION


SPECIAL FUNC

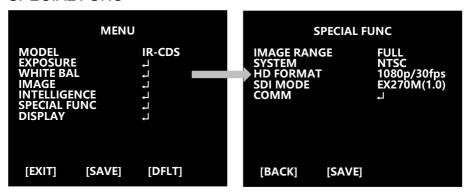

- ♦ IMAGE RANGE : Set the bit range of video image
 - ► FULL, COMP, USER 4
- ♦ SYSTEM : Select NTSC(30fps) or PAL(25fps).
- HD FORMAT: Set digital video output mode (1080p/30(25)fps, 720p/30(25)fps, 720p/60(50)fps)
- ♦ SDI MODE : Select SDI output mode
 - ► OFF / HD-SDI / EX-SDI 270M (v1.0) / EX-SDI 135M (v2.0)
- COMM : Set camera ID, baud rate and protocol
 - - **►** 1 ~ 255
 - ▷ BAUD RATE : Set the speed of serial communication
 - ► 2400 / 4800 / 9600 / 19200 / 38400 / 57600 / 115200bps
 - ▷ PROTOCOL : Select a protocol
 - ► VISCA / PELCO-D / PELCO-P / UPDATE

DISPLAY

DISPLAY

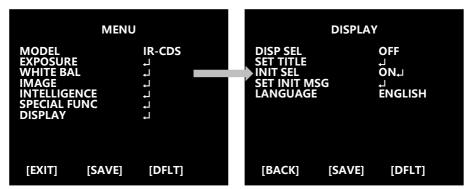

- DISP SEL: Select items to display on the screen
 - ► OFF / ON4
 - ▷ ID : OFF / ON ▷ TITLE : OFF / ON
 - SYSTEM INIT MSG: OFF / ON (MD Alarm and Wait message)
- SET TITLE : Configure camera title (Text edit - max 40 characters are allowed)
- NIT SEL: Select messages to display on the initial screen page
 - ► OFF / ON4
 - ▷ ID : OFF / ON ▷ BAUDRATE : OFF / ON
 - ▷ PROTOCOL : OFF / ON ▷ VERSION : OFF / ON
 - ▷ INIT MSG : OFF / ON
- SET INIT MSG: modify initial message. (Text edit - max 40 characters are allowed)
- ♦ LANGUAGE : Select a language to display
 - ► English / Simplified Chinese / Traditional Chinese / Japanese
 - * Character Table of Text edit Mode

```
A B C D E F G H I J K L M N O P Q R S T U V W X Y Z a b c d e f g h i j k I m n o p q r s t u v w x y z , . () { } [ ] 0 1 2 3 4 5 6 7 8 9 * + - / = ~!?" '
```

SPECIFICATIONS

Image Sensor	1/2.9" Sony Exmor CMOS Sensor			
Total Pixels	2000(H) x 1121(V) = 2.24M pixels			
Active pixels	1936(H) x 1097(V) = 2.12M pixels			
Lens	Varifocal Lens f = 2.8mm ~ 12mm, F 1.4			
FOV	Horizontal: 103°~30.8°, Vertical: 74.4°~23.3°			
IR-LED	High Power IR-LED 4pcs (Up to 50m)			
Digital Zoom	2x ~ 32x			
Resolution	Digital : 1080p 30(25)fps, 720p 60(50)/30(25)fps Analog : 700TVL			
Min. illumination	Color(1/30s): 0.5 lux, BW(1/30s): 0.1lux Color DSS(1/8s): 0.125 lux, BW DSS(1/8s): 0.025 lux			
Video Output	HD : HD-SDI Note1, EX-SDI Analog SD : CVBS (※Test purpose only)			
S/N Ratio	more than 50dB (AGC off)			
Comm. Baudrate	2400 / 4800 / 9600 / 19200 / 38400 / 57600 / 115200			
Focusing Mode	Auto / Manual			
Shutter Speed	1/30(25) ~ 1/30,000 sec			
WDR/BLC	OFF / WDR / BLC			
White Balance	Auto/One Push/Manual/Indoor/Outdoor/Auto-Ext			
Power Source	DC12V±10%			
Power Consumption	DC 12V : MAX 700mA			
Storage Temperature	-20℃ ~ +60℃ (Humidity : 0%RH ~ 90%RH)			
Operating Temperature	-10℃ ~ +50℃ (Humidity : 0%RH ~ 90%RH)			
Weight	1,088g			

		P/N : PRINTEI	D IN KORE
Distributed by		P/N : PRINTEI	D IN KORE
Distributed by		P/N : PRINTEI	D IN KORE
Distributed by		P/N : PRINTEI	D IN KORE
Distributed by		P/N : PRINTEI	D IN KORE.