


Zero Phase Current Transformer (ZCT)

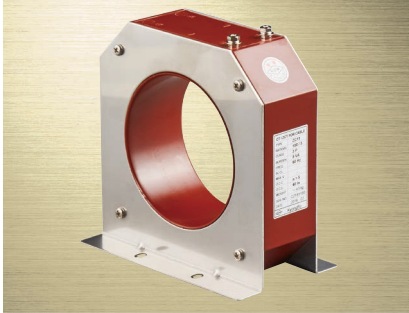

- Standard : JEC 1201
- Frequency : 60 Hz (Others on request)
- Insulation Level : For Cable
Dependent on the operating voltage for the cable and bushing to be used

Zero Phase Primary Current	300A	100A	50A
Zero Phase Secondary Current	5A		
Accuracy Class	3P		
Rated Burden	15VA	5VA	2.5VA

- Over Current Factor : $n > 5$
- Insulation : Epoxy molding (Polyester Mold)

Type	In Dia (Ø)	Dimension (mm)								Weight(kg)
		A	B	C	D	E	F	G	H	
ZC 09	95	153	95	155	78.5	58	100	2	77	≅ 4
ZC 11	110	170	110	172	87					≅ 4.5
ZC 15	150	220	150	222	112					≅ 6.5
ZC 20	200	282	200	284	143					≅ 9
ZC 40	400	370	25	50	—	—	—	—	—	≅ 9

Dimension & Drawing

